



2006 Honda CR-V

VIN: JHLRD78506C216277

Inspection Date: July 25, 2026

Prepared By: MotorInspect

Exterior	2
Engine Bay	6
Tyres and Wheels	8
Interior	9
Glass	14
Underbody	14
Electrical System	16
Road Test Findings	16
Final notes	17

Inspection Information

Inspection Date: 2026-07-25

Model: CR-V

VIN: JHLRD78506C216277

Engine: 4 cylinder

Client Name: Roxy Smith

Year: 2006

REGO: 1IEV654

Body Style: SUV

Drive Type: 4WD

Interior Color: Gray

Make: Honda

Mileage: 107354

Transmission: Automatic

Inspector: MotorInspect

Exterior Color: Silver

G = Good - This item is in good condition and/or is performing to standard.

F = Fair - This item is in fair condition and is in working order with some visible signs of deterioration and wear consistent with age and mileage

P = Poor - This item is in poor condition and/or is performing below standard.


Exterior

Y (N)

G F P

- | | | | |
|-------------------------------------|-------------------------------------|-------------------------------------|--|
| ☒ | ☐ | ☐ | 1. Clean exterior - Dirty |
| ☒ | ☐ | ☐ | 2. Bonnet |
| ☐ | ☒ | ☐ | 3. Front Bumper - Misaligned |
| ☒ | ☐ | ☐ | 4. Left hand Fender |
| ☐ | ☒ | ☐ | 5. Left hand Doors - Dents, cracks or scratches present |
| ☐ | ☒ | ☐ | 6. Left hand 3/4 panel |
| ☒ | ☐ | ☐ | 7. Rear |
| ☐ | ☒ | ☐ | 8. Rear Bumper - Dents, cracks or scratches present |
| ☒ | ☐ | ☐ | 9. Boot |
| ☐ | ☐ | ☒ | 10. Right hand 3/4 panel - Has damage |
| ☐ | ☒ | ☐ | 11. Right hand Doors |
| ☐ | ☒ | ☐ | 12. Right hand Fender |
| ☒ | ☐ | ☐ | 13. Roof |
| ☒ | ☐ | ☐ | 14. Trim |
| ☒ | ☐ | ☐ | 15. Fuel Door |
| ☐ | ☒ | ☐ | 16. Paint Condition - Dents, cracks or scratches present |
| ☐ | ☐ | ☒ | 17. Paint thickness - Using paint thickness gauge, paint thickness is not consistent on the body. Right hand side fender has more paint thickness. |


Bonnet

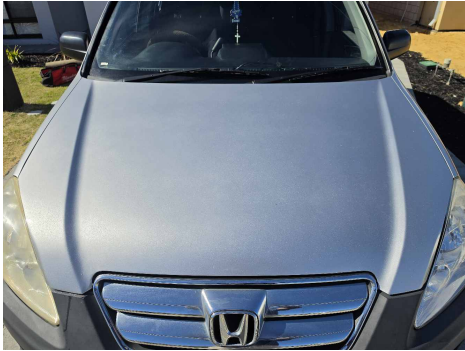


Front Bumper 1




Front Bumper 2

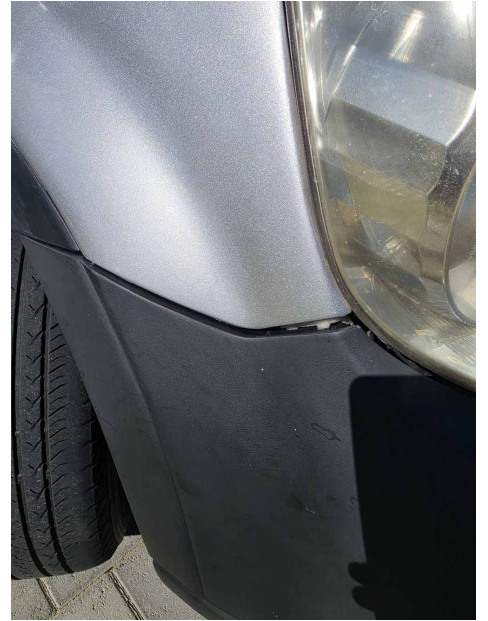


Left hand Fender

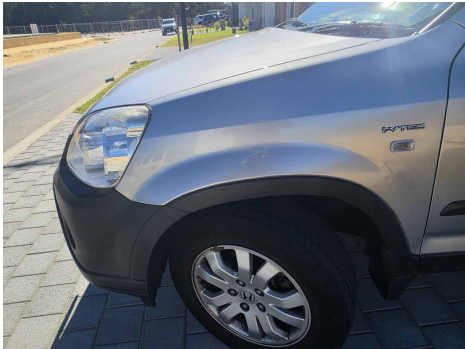

Left hand Doors 1

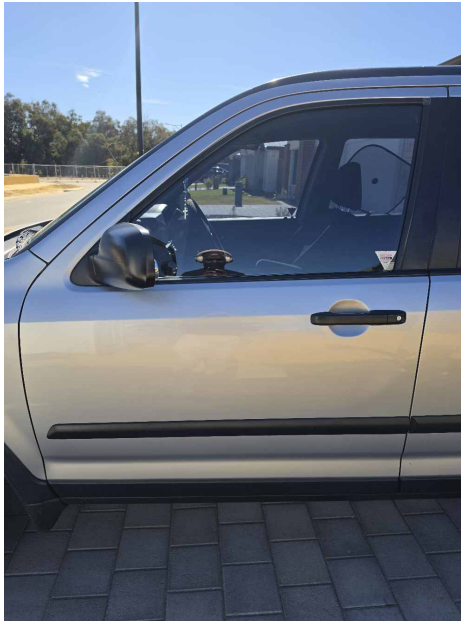


Left hand Doors 2

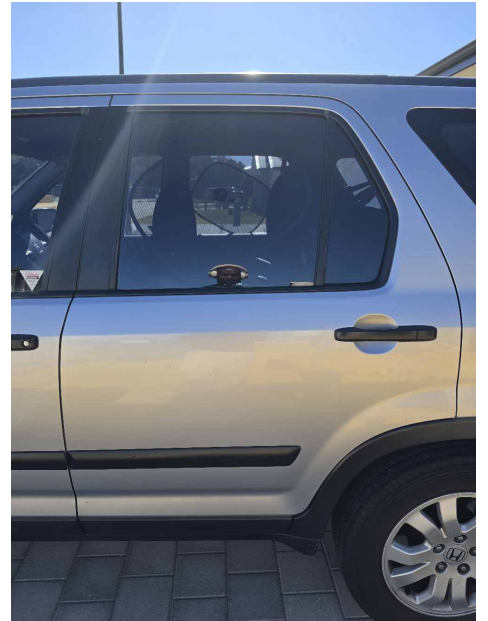

Left hand 3/4 panel 1



Left hand 3/4 panel 2

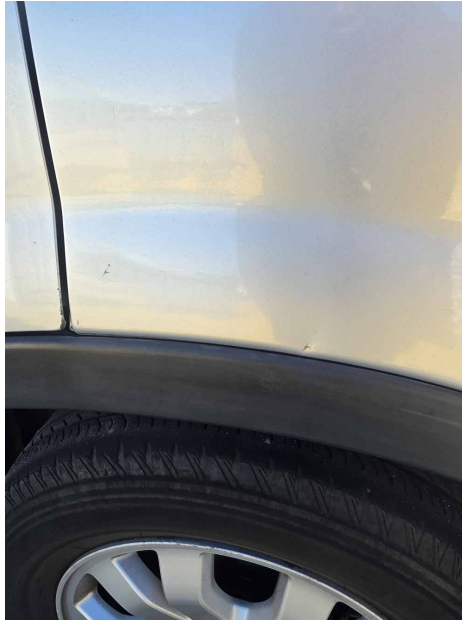

Rear



Rear Bumper 1



Rear Bumper 2




Rear Bumper 3




Right hand 3/4 panel 1



Right hand 3/4 panel 2

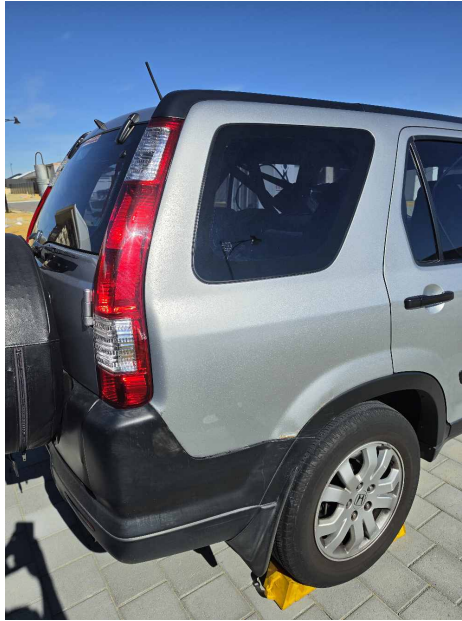


Right hand Doors 1

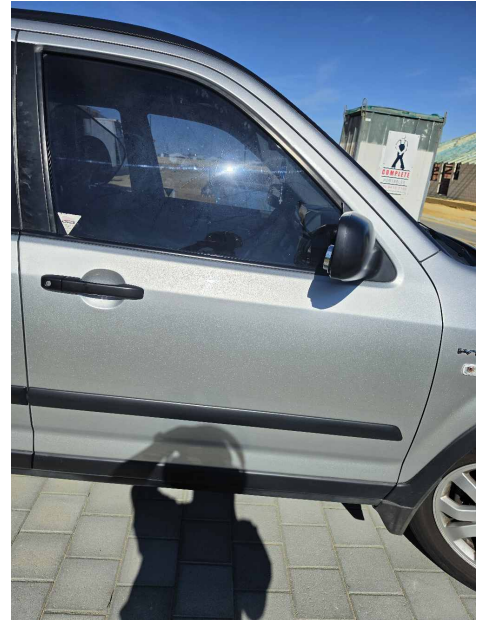


Right hand Doors 2




Right hand Fender

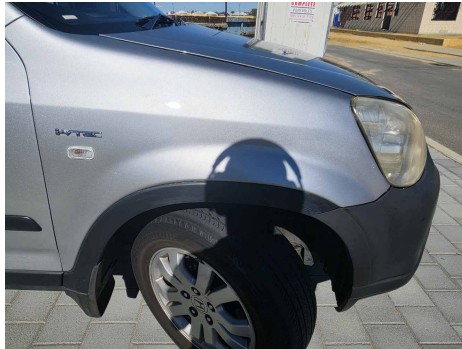


Roof 1

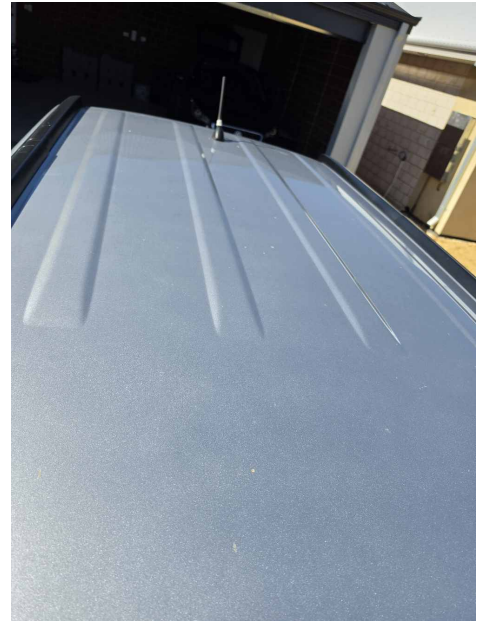

Roof 2

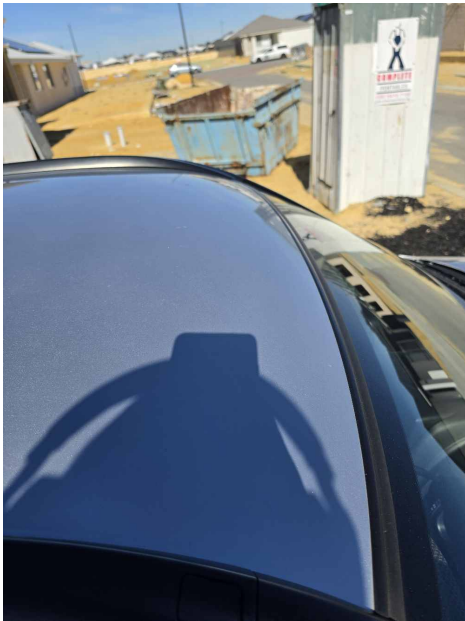

Paint thickness 1

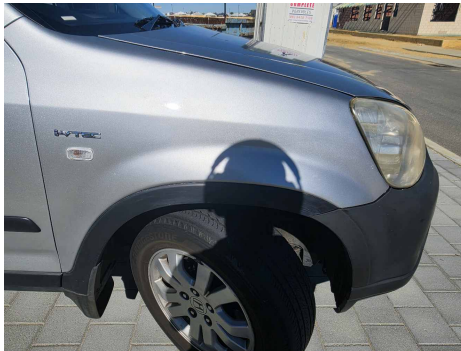

Paint thickness 2




Engine Bay

G	F	P	
☐	☒	☐	18. Engine Compartment - Dirty
☐	☐	☒	19. Battery - Excessive corrosion present Failed battery health test. Needs replacement.
☒	☐	☐	20. Wiring
☒	☐	☐	21. Belts
☐	☒	☐	22. Engine oil - Dirty looking oil
☒	☐	☐	23. Hoses
☒	☐	☐	24. Brake fluid level and condition
☐	☒	☐	25. Washer bottle fluid level - Low level Bottle cap cracked
☒	☐	☐	26. Coolant level
☒	☐	☐	27. Radiator and radiator cap
☒	☐	☐	28. Coolant leaks
☒	☐	☐	29. Fuel system
☒	☐	☐	30. Ignition system
☒	☐	☐	31. Mountings


Engine Compartment




Battery 1

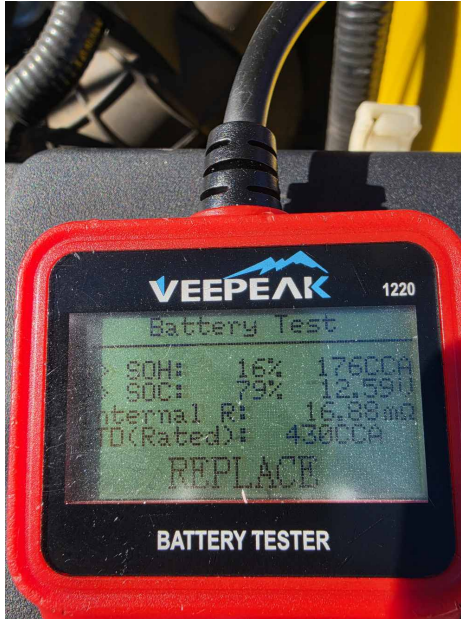

Battery 2

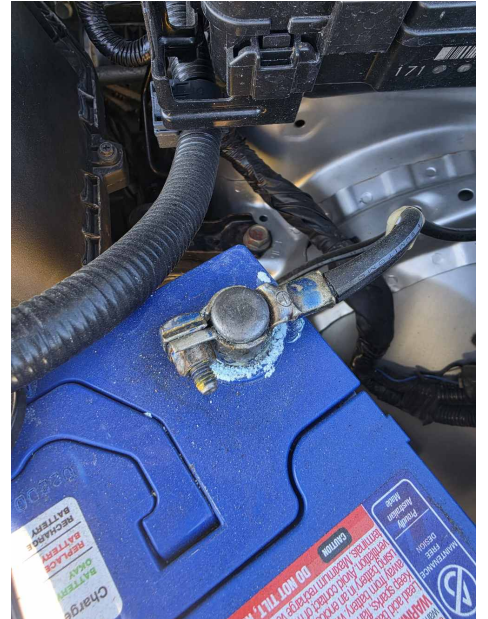


Engine oil

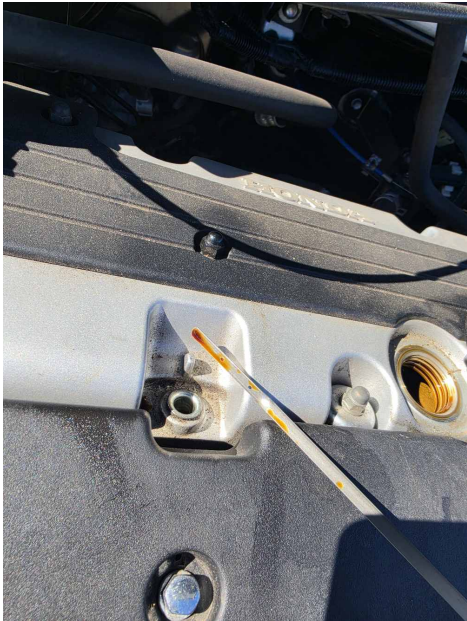

Washer bottle fluid level



Radiator and radiator cap

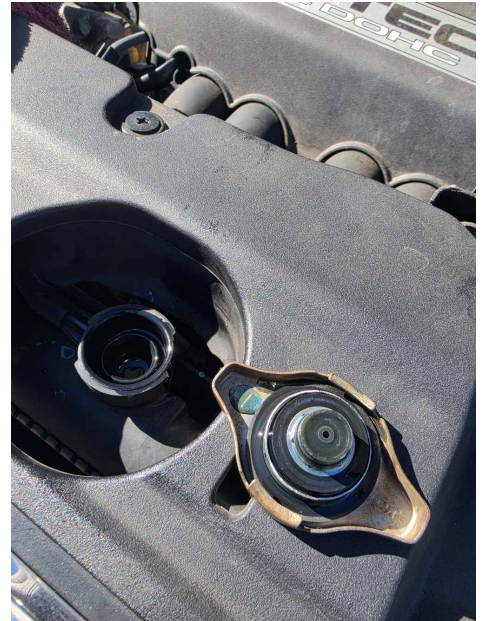

Tyres and Wheels

G F P
☐ ☐ ☒

32. Condition of Tires - All tires need replaced,
Sidewall damage,
Wear indicates misalignment

☐ ☒ ☐

33. Condition of Wheels - Scratches present

☒ ☐ ☐

34. Spare Tire

☒ ☐ ☐

35. Front brakes

☐ ☒ ☐

36. Rear brakes - Rear brakes slightly worn. Need replacement soon


☐ ☒ ☐

37. Park brake - Needs adjustment.


Condition of Tires 1



Condition of Tires 2

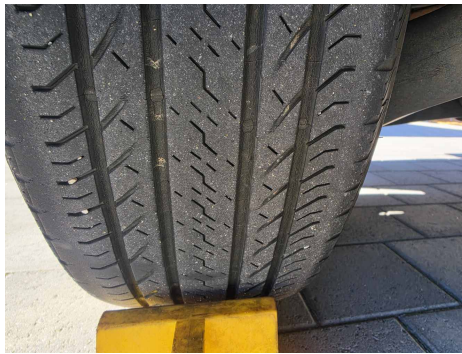


Condition of Tires 3

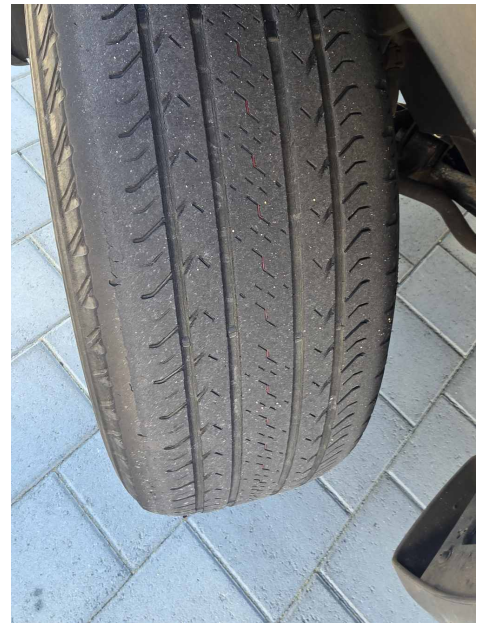


Condition of Tires 4



Condition of Wheels 1

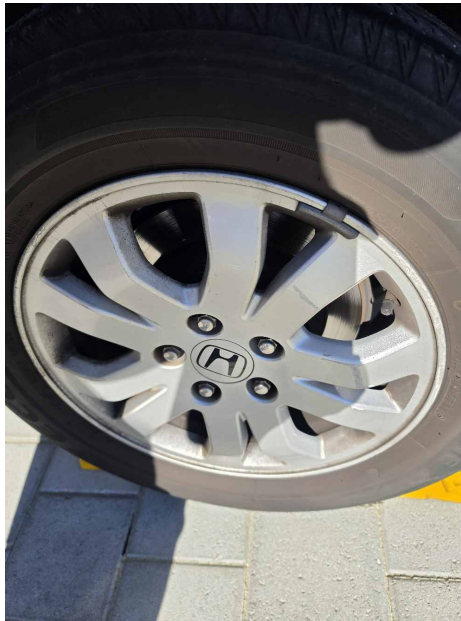

Condition of Wheels 2

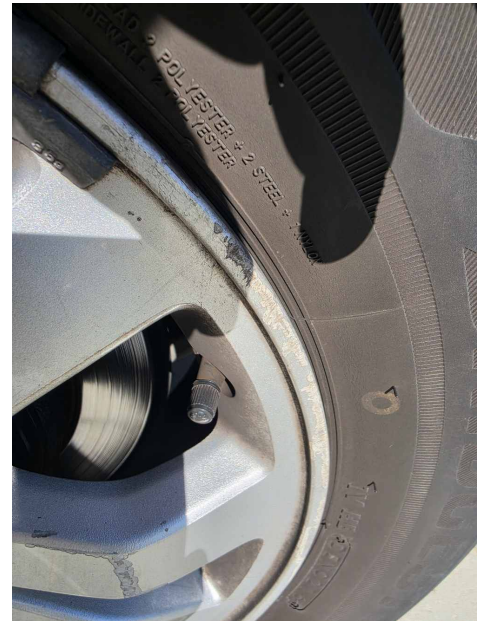


Interior


- | | | |
|---|-------------------------------------|--|
| Y | ☐ | 38. Interior clean - Dirty |
| Y | ☐ | 39. Pet odour |
| Y | ☐ | 40. Cigarette smell |
| ☒ | ☐ | 41. 2 keys or more present - 2 keys.
Working remote |
| | | |
| G | F | P |
| ☐ | ☒ | ☐ |
| 42. Stamped Service history - Has good service history.
Last recorded service was at 84000km in 2023.
No service records after | | |
| ☒ | ☐ | ☐ |
| 43. Seats | | |
| ☐ | ☒ | ☐ |
| 44. Carpet - Floor mats do not match interior | | |
| ☒ | ☐ | ☐ |
| 45. Door Panels - Scratched | | |
| ☒ | ☐ | ☐ |
| 46. Glove Box | | |
| ☒ | ☐ | ☐ |
| 47. Vanity Mirrors | | |
| ☒ | ☐ | ☐ |
| 48. Interior Trim | | |
| ☒ | ☐ | ☐ |
| 49. Dashboard | | |
| ☒ | ☐ | ☐ |
| 50. Dashboard Gauges | | |

- | | | | |
|-------------------------------------|-------------------------------------|--------------------------|--|
| ☒ | ☐ | ☐ | 51. Gear lever condition |
| ☒ | ☐ | ☐ | 52. Sunroof/Convertible operation - NA |
| ☒ | ☐ | ☐ | 53. Air Conditioning |
| ☒ | ☐ | ☐ | 54. Heater |
| ☒ | ☐ | ☐ | 55. Defroster |
| Y | ☒ | ☐ | 56. Warning lights |
| Y | ☒ | ☐ | 57. Interior lights working |
| ☒ | ☐ | ☐ | 58. Build plate |
| ☒ | ☐ | ☐ | 59. Compliance plate |


2 keys or more present

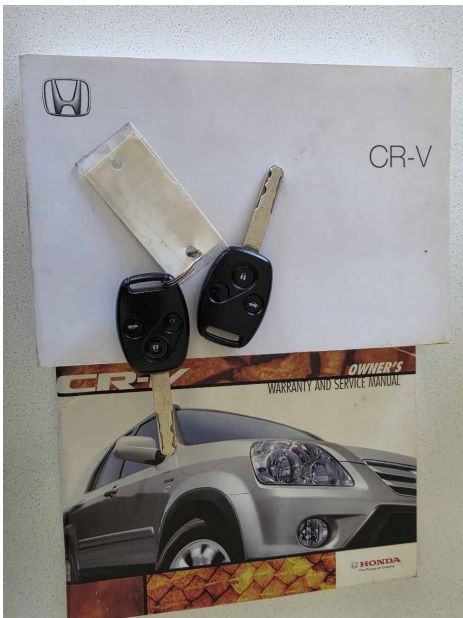

Stamped Service history 1

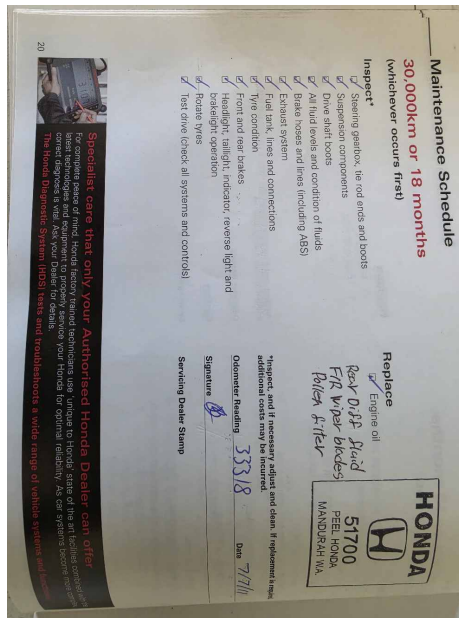

Stamped Service history 2

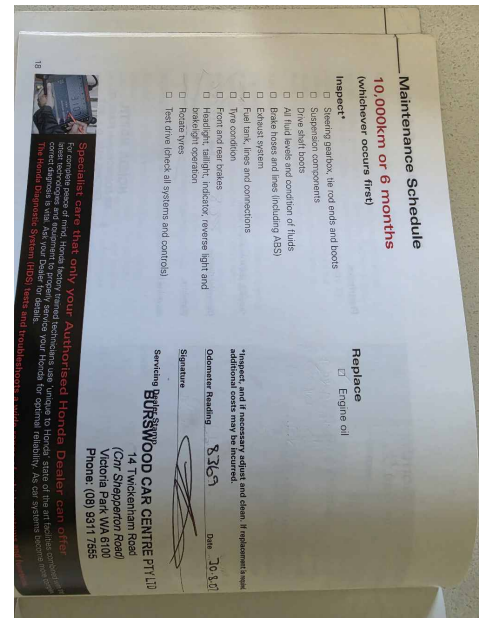

Stamped Service history 3

Maintenance Schedule
60,000km or 36 months
(whichever occurs first)

Inspect*

- Steering gearbox, tie rod ends and boots
- Suspension components
- Drive shaft boots
- All fluid levels and condition of fluids
- Brake hoses and lines (including ABS)
- Exhaust system
- Fuel tank, lines and connections
- Tire condition
- Front and rear brakes
- Headlight, taillight, indicator, reverse light and brake light operation
- Horn
- Washers (check all systems and controls)

Replace

- Engine oil
- Brake fluid (includes ABS)
- Air filter
- Wipers
- Rear Brake Pads

Notes: *If necessary, adjust and clean. If replacement is required, additional costs may be incurred.

Customer Reading: 65128 Date: 28/01/11

Signature: [Signature] Servicing Dealer Stamp: [Stamp]

Stamped Service history 4

Maintenance Schedule
50,000km or 30 months
(whichever occurs first)

Inspect*

- Steering gearbox, tie rod ends and boots
- Suspension components
- Drive shaft boots
- All fluid levels and condition of fluids
- Brake hoses and lines (including ABS)
- Exhaust system
- Fuel tank, lines and connections
- Tire condition
- Front and rear brakes
- Headlight, taillight, indicator, reverse light and brake light operation
- Horn
- Washers (check all systems and controls)

Replace

- Engine oil
- Oil Filter

Notes: *If necessary, adjust and clean. If replacement is required, additional costs may be incurred.

Customer Reading: 55,715 Date: 21/11/10

Signature: [Signature] Servicing Dealer Stamp: [Stamp]

Stamped Service history 5

Maintenance Schedule
60,000km or 36 months
(whichever occurs first)

Inspect*

- Steering gearbox, tie rod ends and boots
- Suspension components
- Drive shaft boots
- All fluid levels and condition of fluids
- Brake hoses and lines (including ABS)
- Exhaust system
- Fuel tank, lines and connections
- Tire condition
- Front and rear brakes
- Headlight, taillight, indicator, reverse light and brake light operation
- Horn
- Washers (check all systems and controls)

Replace

- Engine oil
- Brake fluid (includes ABS)
- Air filter
- Wipers
- Rear Brake Pads

Notes: *If necessary, adjust and clean. If replacement is required, additional costs may be incurred.

Customer Reading: 65128 Date: 28/01/11

Signature: [Signature] Servicing Dealer Stamp: [Stamp]

Stamped Service history 6

Maintenance Schedule
70,000km or 42 months
(whichever occurs first)

Inspect*

- Steering gearbox, tie rod ends and boots
- Suspension components
- Drive shaft boots
- All fluid levels and condition of fluids
- Brake hoses and lines (including ABS)
- Exhaust system
- Fuel tank, lines and connections
- Tire condition
- Front and rear brakes
- Headlight, taillight, indicator, reverse light and brake light operation
- Horn
- Washers (check all systems and controls)

Replace

- Engine oil
- Oil Filter
- Brake fluid (includes ABS)
- Air filter
- Wipers
- Rear Brake Pads

Notes: *If necessary, adjust and clean. If replacement is required, additional costs may be incurred.

Customer Reading: 69142 Date: 26/11/18

Signature: [Signature] Servicing Dealer Stamp: [Stamp]

Stamped Service history 7

Supplementary Maintenance Record


Signature	Customer Reading	Date	km / months
[Signature]	15,000	15/11	7.2.08
[Signature]	75,000	7/10/15	21.5.2010
[Signature]	10,000	10/11/15	01.6.15
[Signature]	10,000	10/11/15	01.6.15

Notes: *If necessary, adjust and clean. If replacement is required, additional costs may be incurred.


Customer Reading: 84644 Date: 13-04-23

Signature: [Signature] Servicing Dealer Stamp: [Stamp]

Seats 1

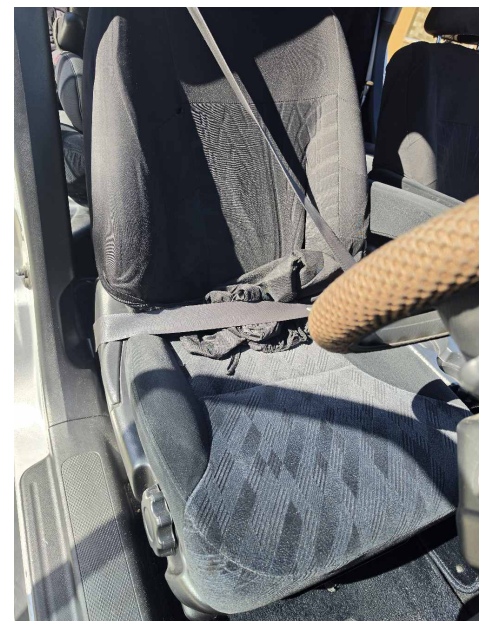

Seats 2

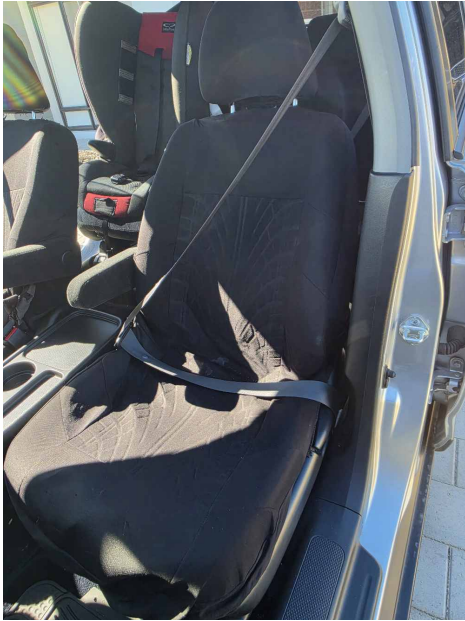

Door Panels 1



Door Panels 2



Door Panels 3



Door Panels 4




Dashboard 1




Dashboard 2




Dashboard 3

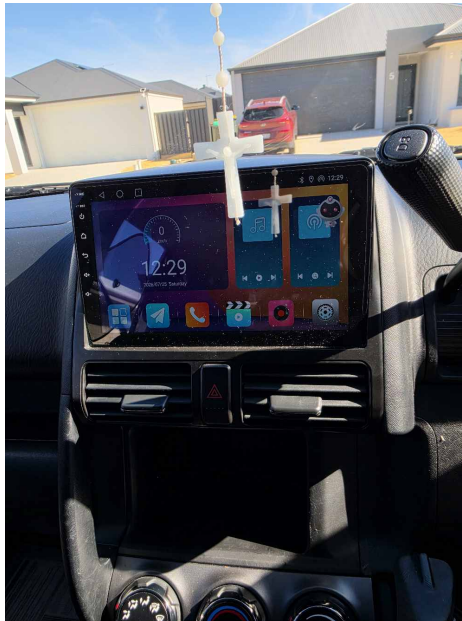

Dashboard Gauges

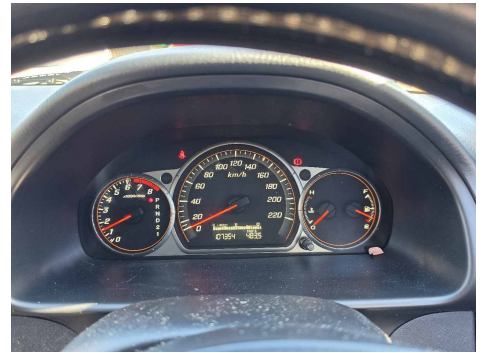

Gear lever condition

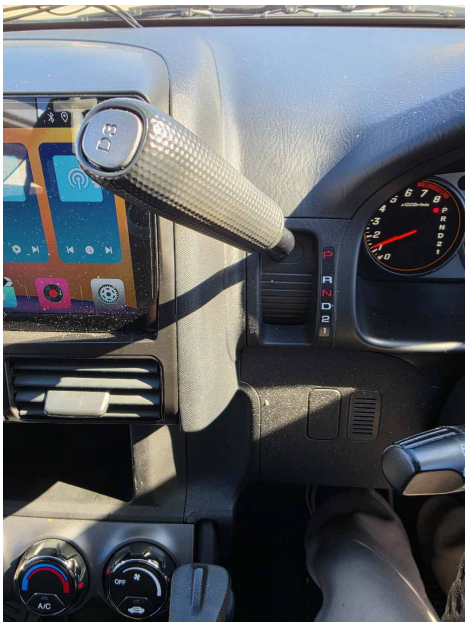

Build plate



Compliance plate



Glass

G	F	P	
☒	☐	☐	60. Windscreen
☐	☐	☒	61. Windscreen wipers - Worn
☒	☐	☐	62. Windows
☒	☐	☐	63. Mirrors
☒	☐	☐	64. Rear Window

Windscreen wipers




Underbody


G	F	P	
☒	☐	☐	65. Frame
☒	☐	☐	66. Exhaust System
☒	☐	☐	67. Transmission
☒	☐	☐	68. Drive Axle
☒	☐	☐	69. Brake System
☒	☐	☐	70. Oil leaks
☒	☐	☐	71. Coolant leaks
☒	☐	☐	72. Rust
☐	☐	☒	73. Front suspension - Lower control arm bushes cracked. Need replacement

- ☒ ☐ ☐ 74. Rear suspension
☒ ☐ ☐ 75. Differential
☒ ☐ ☐ 76. Steering system


Frame 1

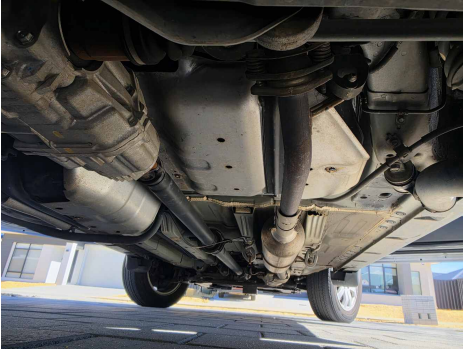


Frame 2

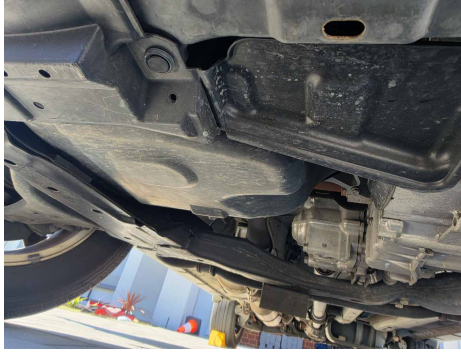


Frame 3

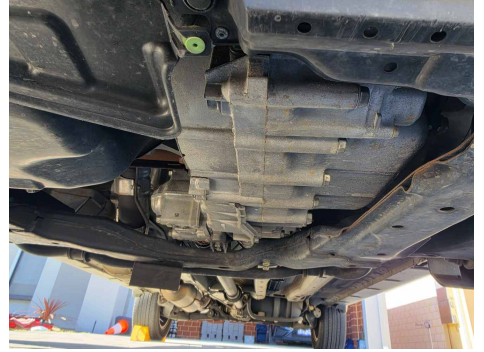

Frame 4

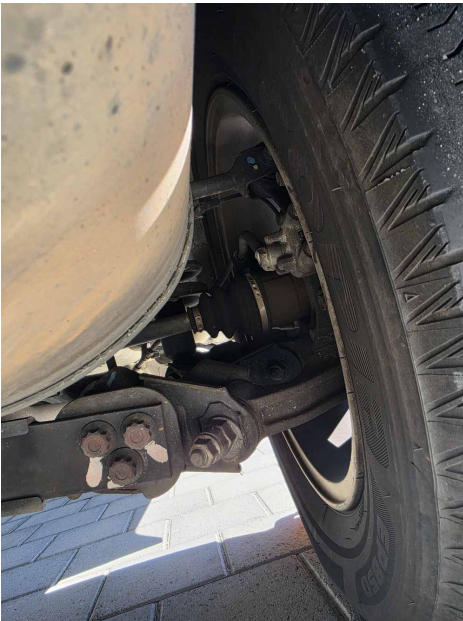

Frame 5

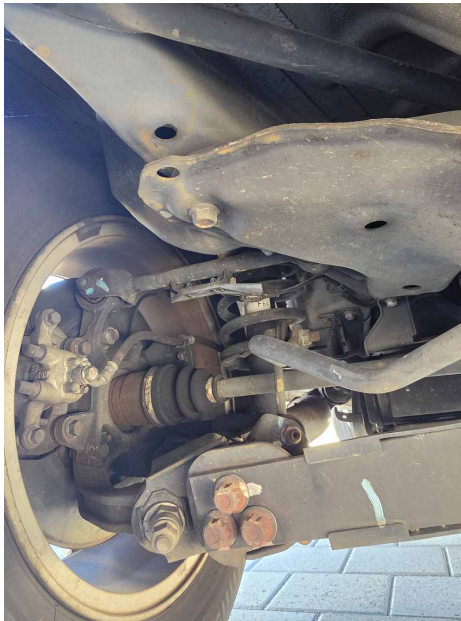

Front suspension



Electrical System

G	F	P	
☒	☐	☐	77. Power Locks
☒	☐	☐	78. Power Seats/Seats
☒	☐	☐	79. Windows
☒	☐	☐	80. Power Mirrors/Mirrors
☒	☐	☐	81. Audio System
☒	☐	☐	82. Headlights
☒	☐	☐	83. Taillights
☐	☐	☒	84. Brake Lights - Right hand side stop light not working
☒	☐	☐	85. Diagnostic Scan codes
☒	☐	☐	86. Parking Lights
☒	☐	☐	87. Indicators



Road Test Findings





G	F	P	
☒	☐	☐	88. Starting
☒	☐	☐	89. Idling
☒	☐	☐	90. Engine Performance
☒	☐	☐	91. Acceleration
☒	☐	☐	92. Transmission Shift Quality
☐	☐	☒	93. Steering - Possible alignment problem
☒	☐	☐	94. Braking
☒	☐	☐	95. Suspension Performance
☒	☐	☐	96. Engine oil tempreature
☒	☐	☐	97. Engine coolant temperature
☒	☐	☐	98. Cruise control
☒	☐	☐	99. Instrument panel
☒	☐	☐	100. Differential noises
☒	☐	☐	101. Wheel bearings
			102. 4WD System



Final notes




103. Final notes





Pictures





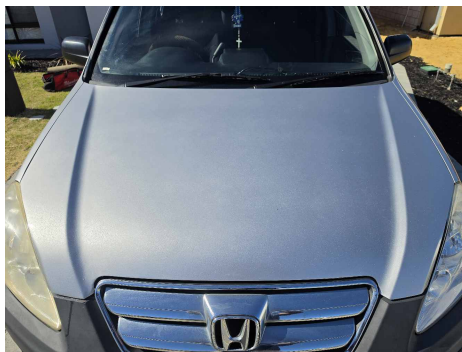
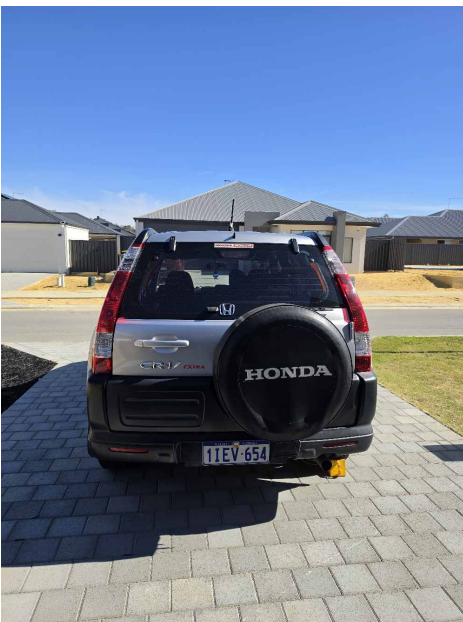


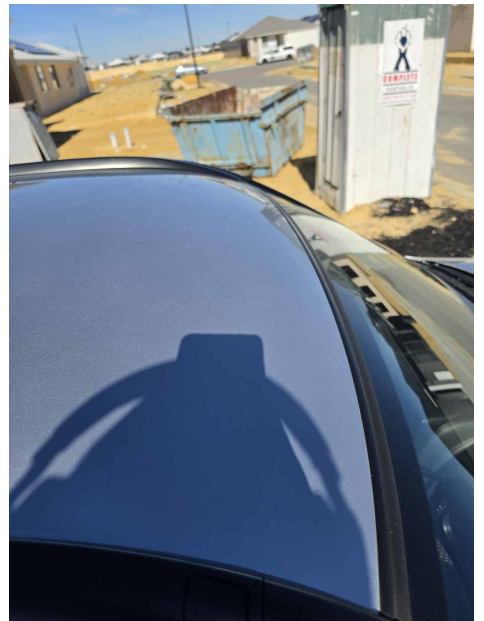
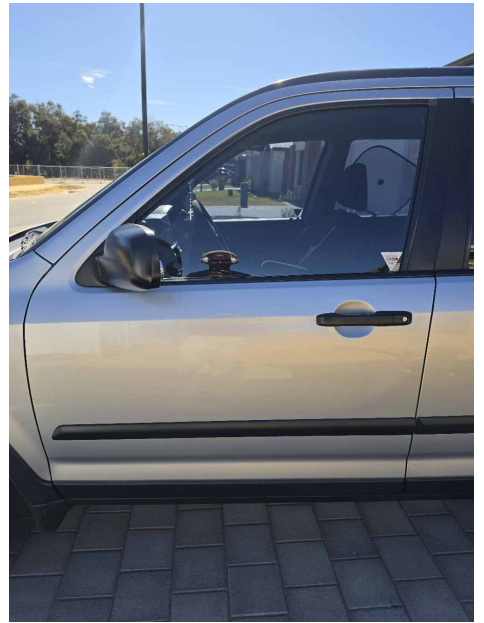
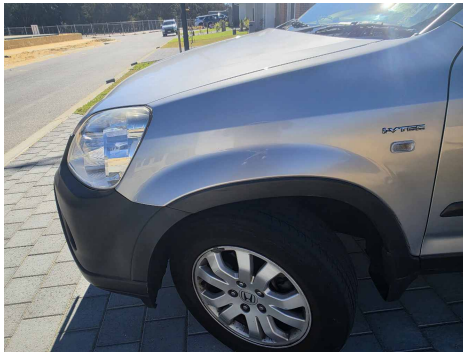
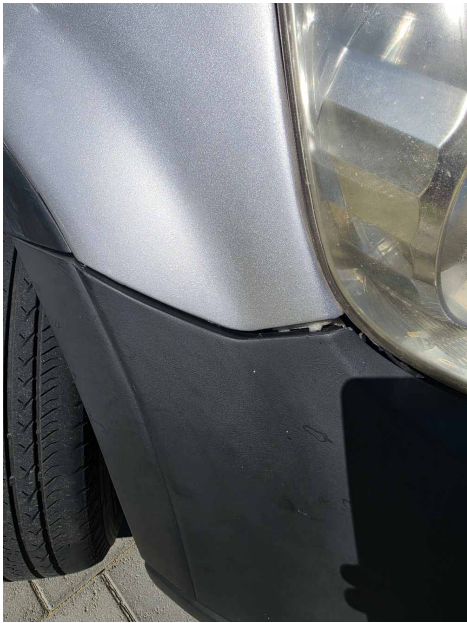



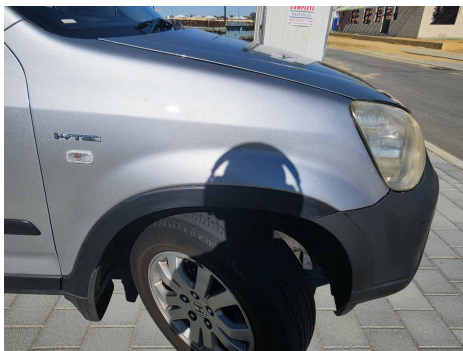
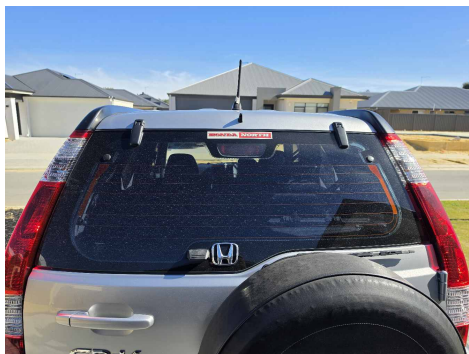



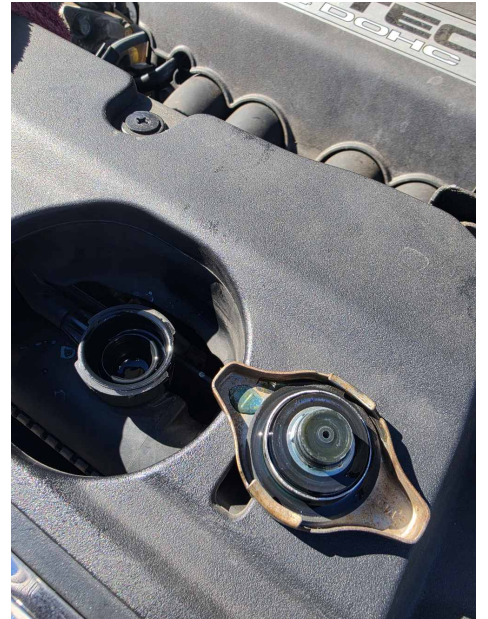
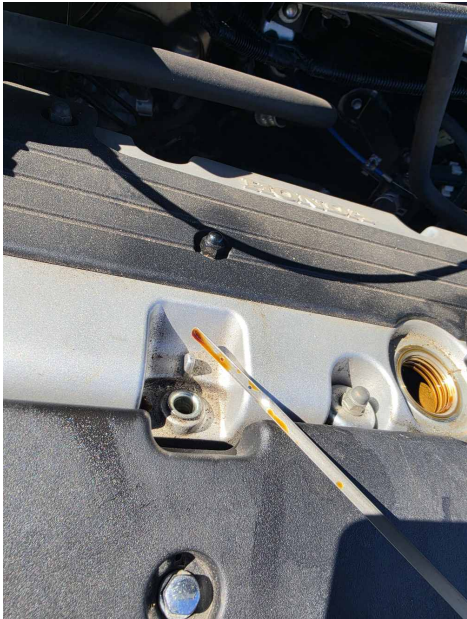
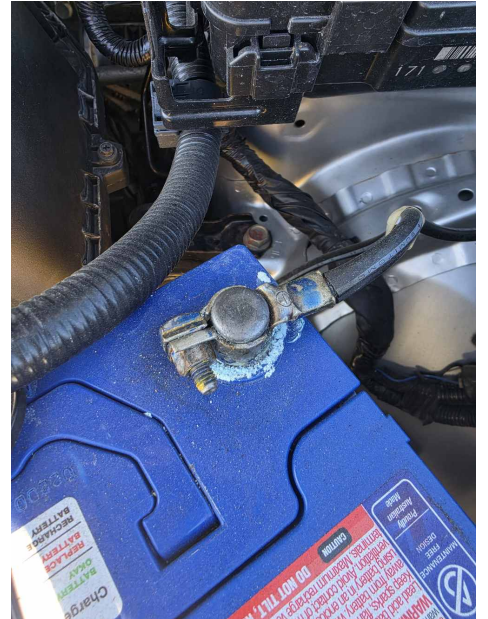



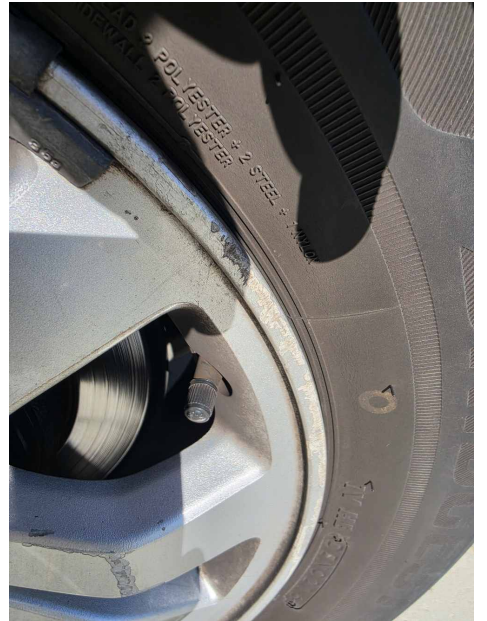
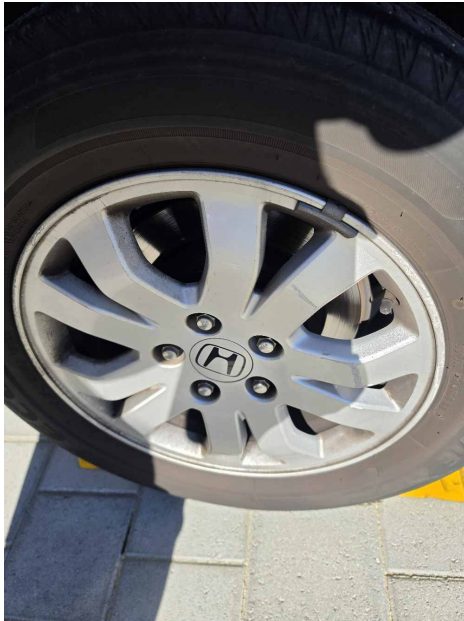
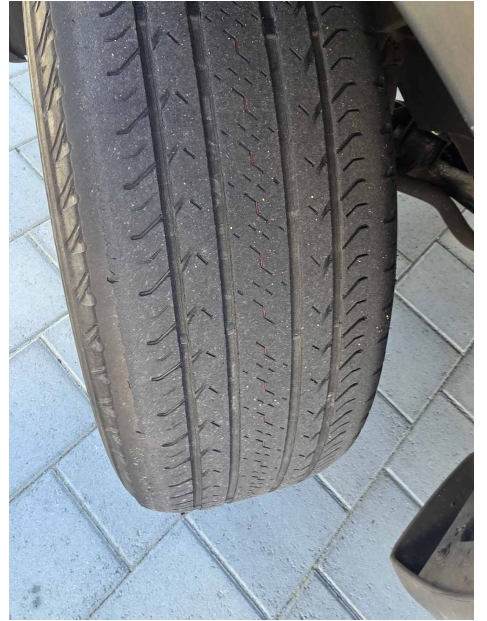
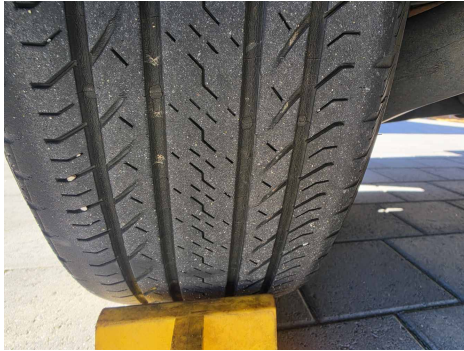


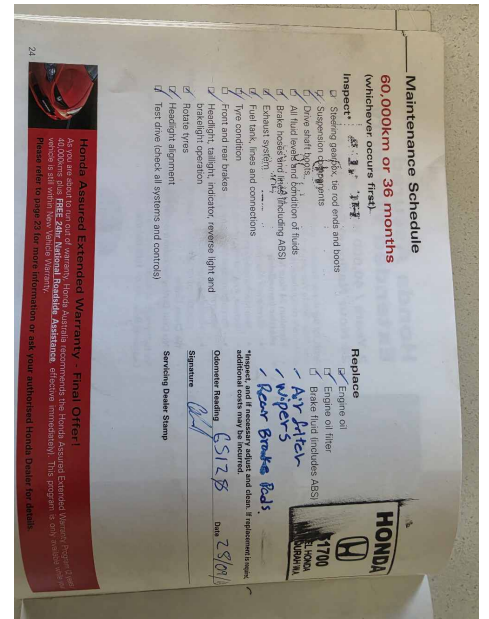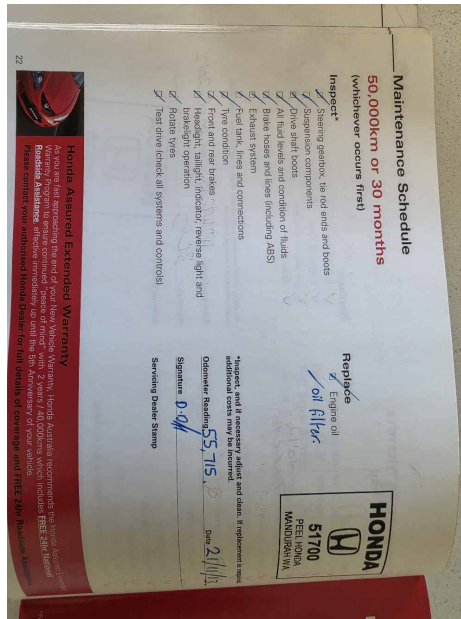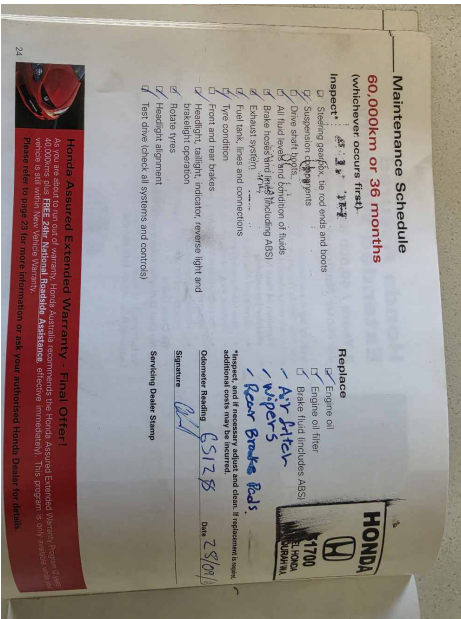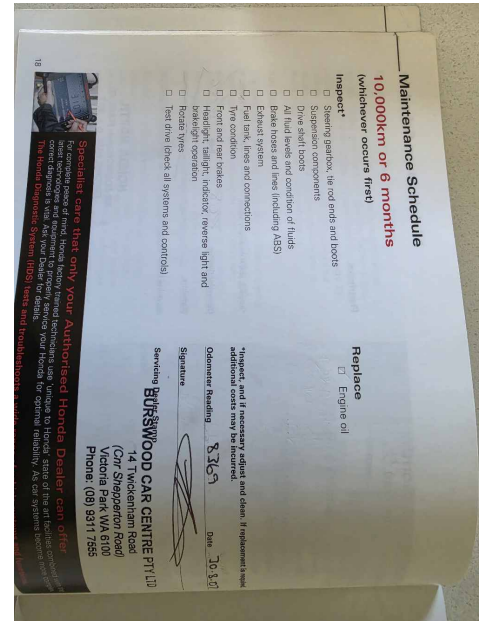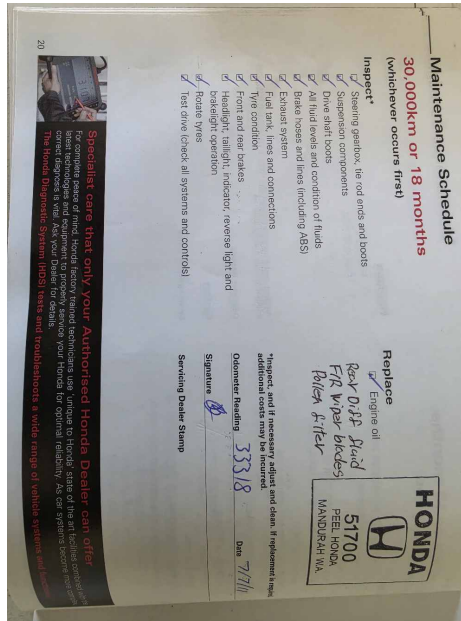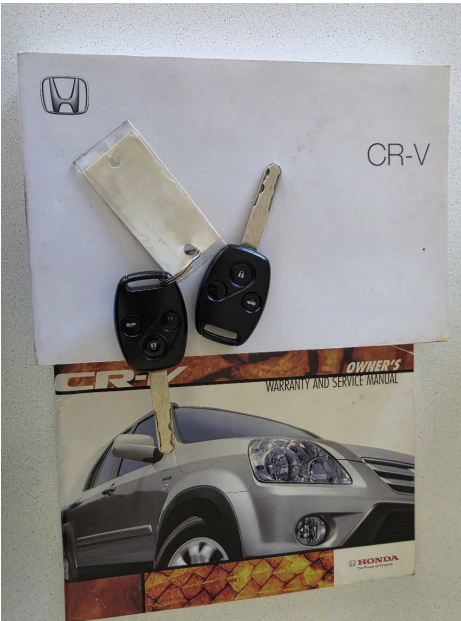

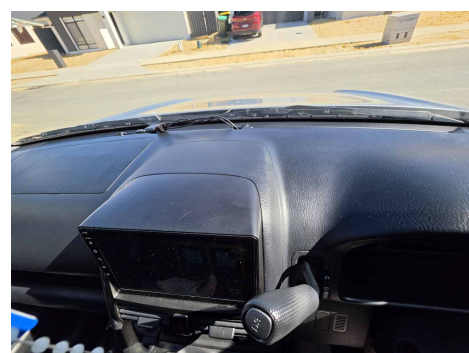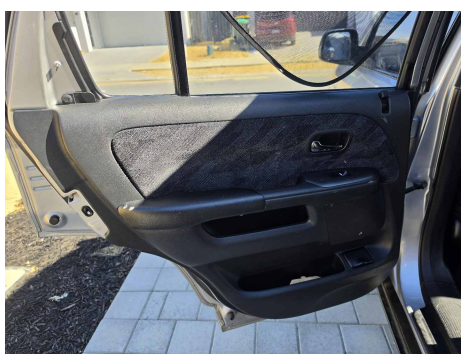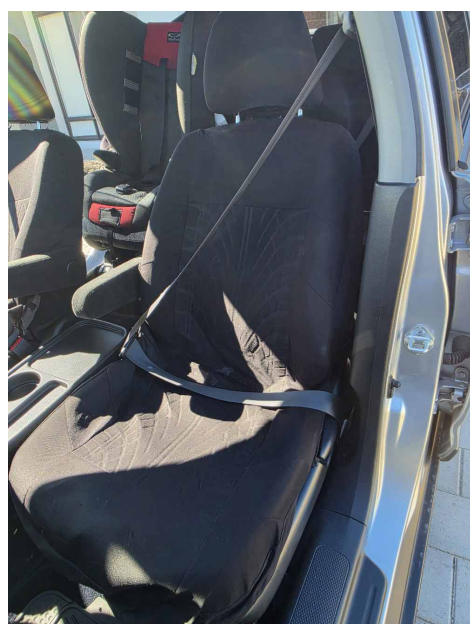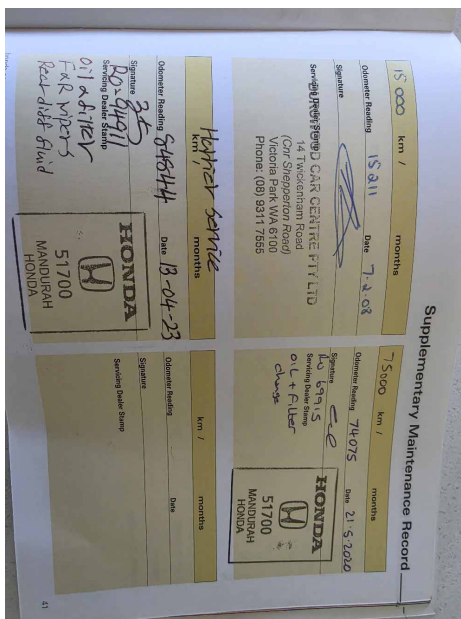

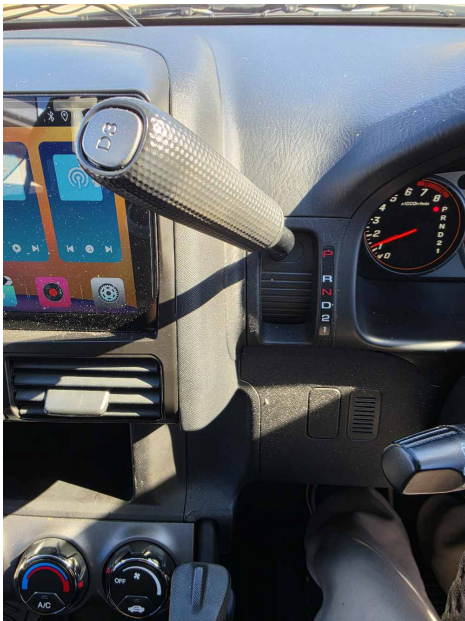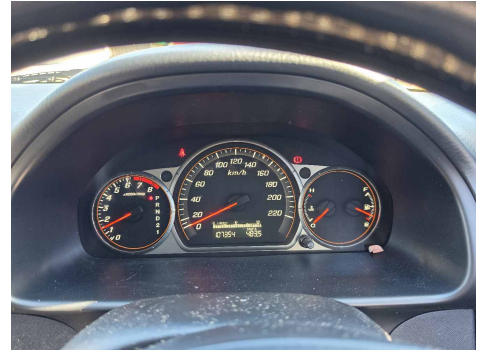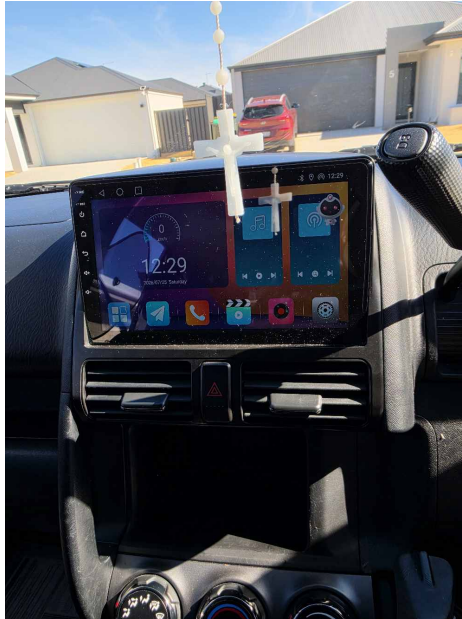

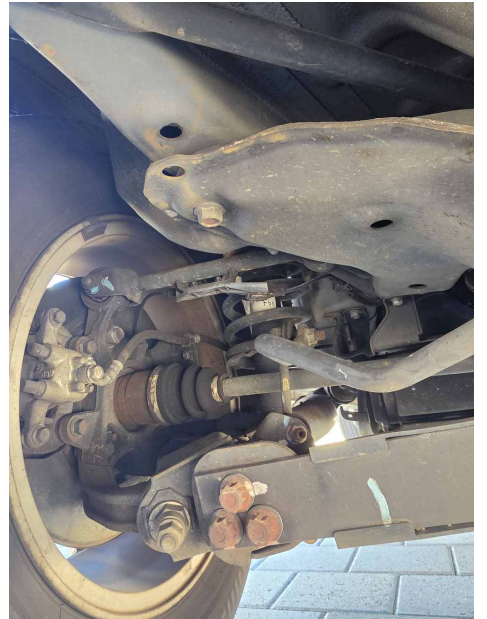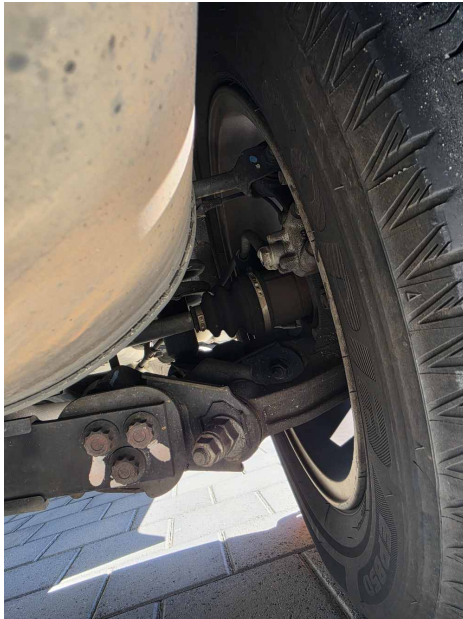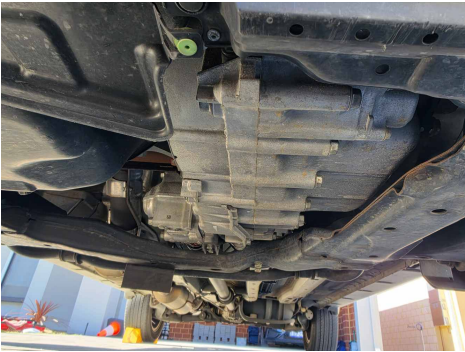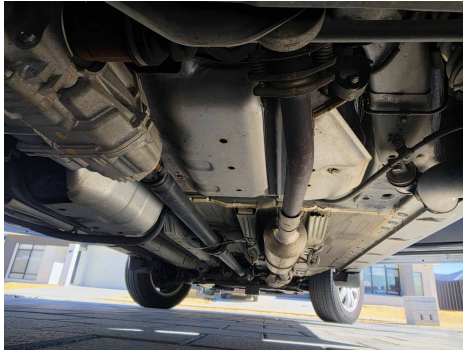

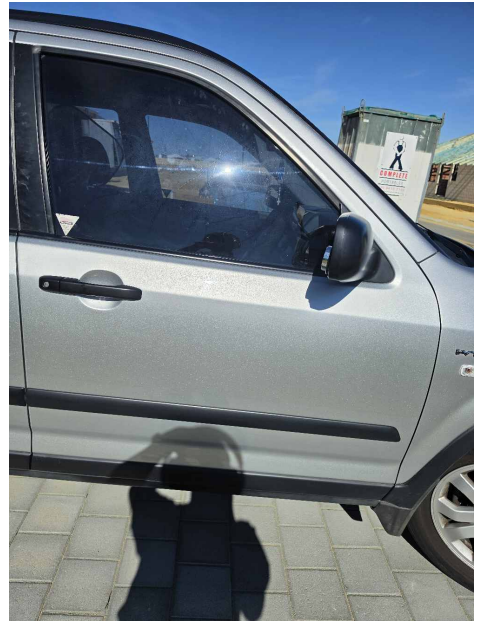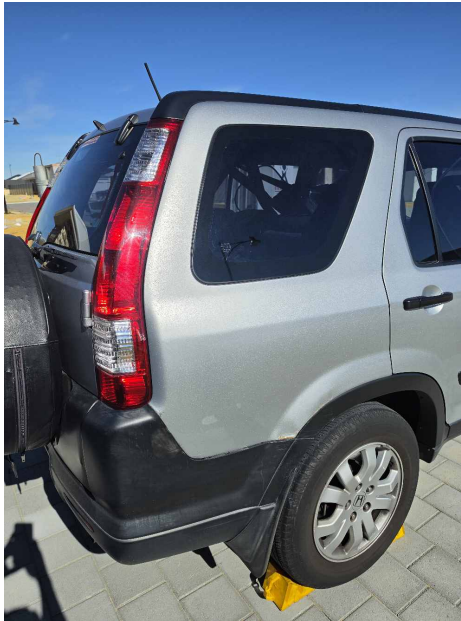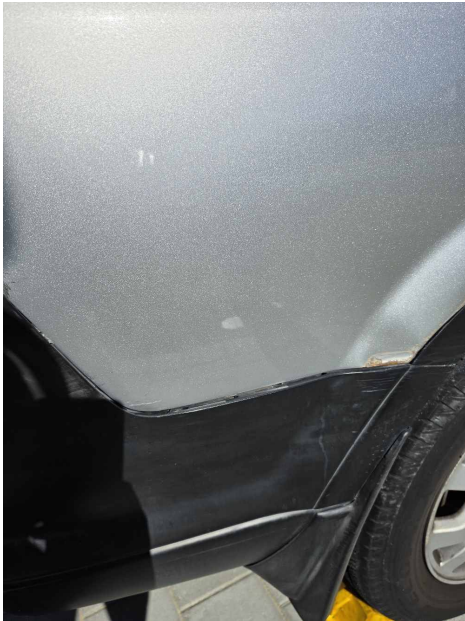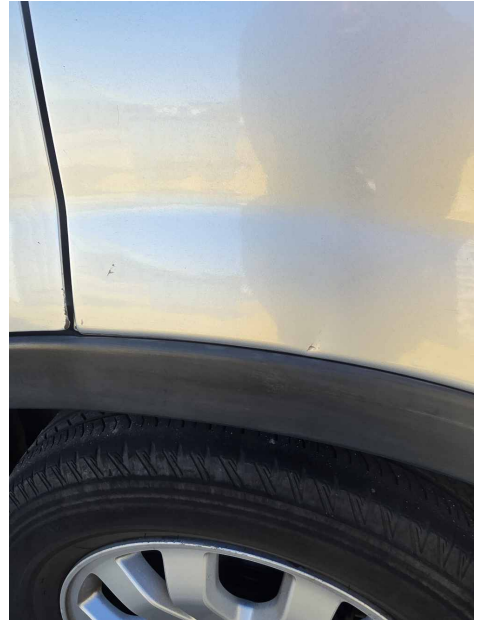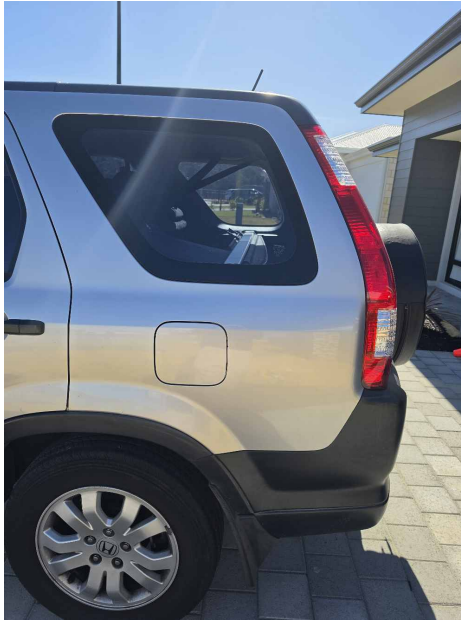



Summary

Poor

Exterior

Right hand 3/4 panel - Has damage

Paint thickness - Using paint thickness gauge, paint thickness is not consistent on the body. Right hand side fender has more paint thickness.

Engine Bay

Battery - Excessive corrosion present

Failed battery health test. Needs replacement.

Tyres and Wheels

Condition of Tyres - All tires need replaced,
Sidewall damage,
Wear indicates misalignment

Glass

Windscreen wipers - Worn

Underbody

Front suspension - Lower control arm bushes cracked. Need replacement

Electrical System

Brake Lights - Right hand side stop light not working

Road Test Findings

Steering - Possible alignment problem